

Blue Print ADM58099, ADBP800555, ADBP800612



To fit:

Mazda 2 2016-, 3 2014-2016, 6 2014-2016, CX-3 2016-,
CX-5 2013-2016, CX-9 2016-



EN

Anti Roll Bar Bush

Problem

Squeaking noise from the suspension system when travelling over uneven surfaces after the anti roll bar bushes have been replaced or lubricated.

Cause

The bushes for the vehicles listed above are designed to be of a grip type which have been incorporated for noise prevention purposes. If any type of grease or lubrication is applied to the bushes during installation, it may create noise due to the bushes slipping on the anti roll bar.

Solution

To prevent noise from occurring, never apply any type of grease or lubrication to the front or rear anti roll bar bushes.

When replacing, only install these anti roll bar bushes when clean and dry and do not use any lubricant during the installation process.

For more technical information please visit: partsfinder.bilsteingroup.com